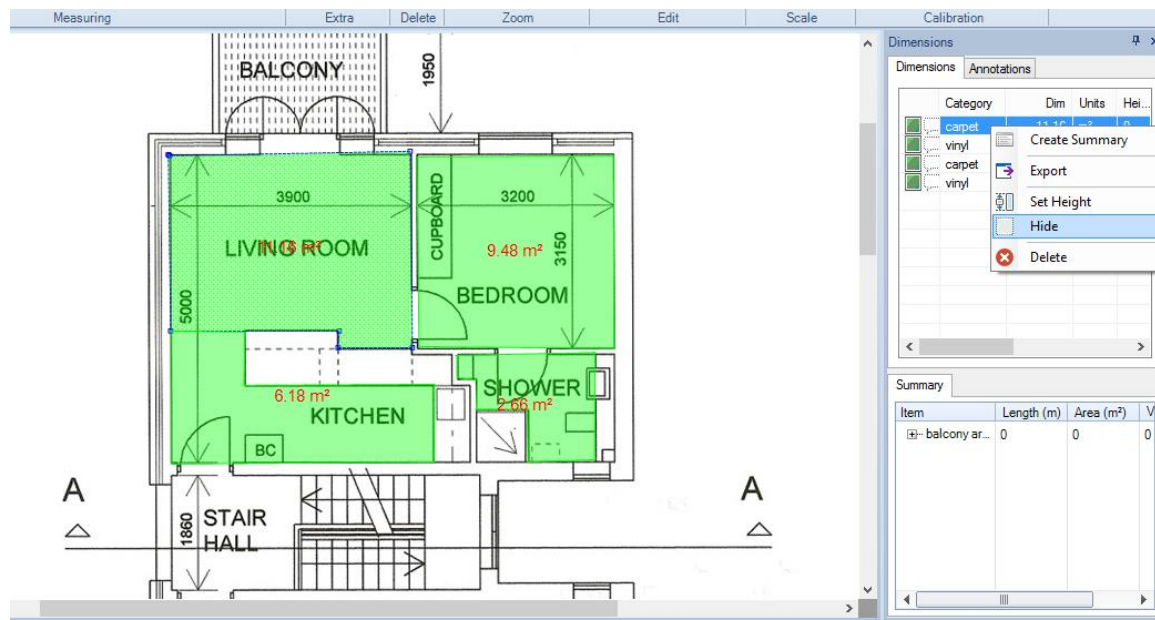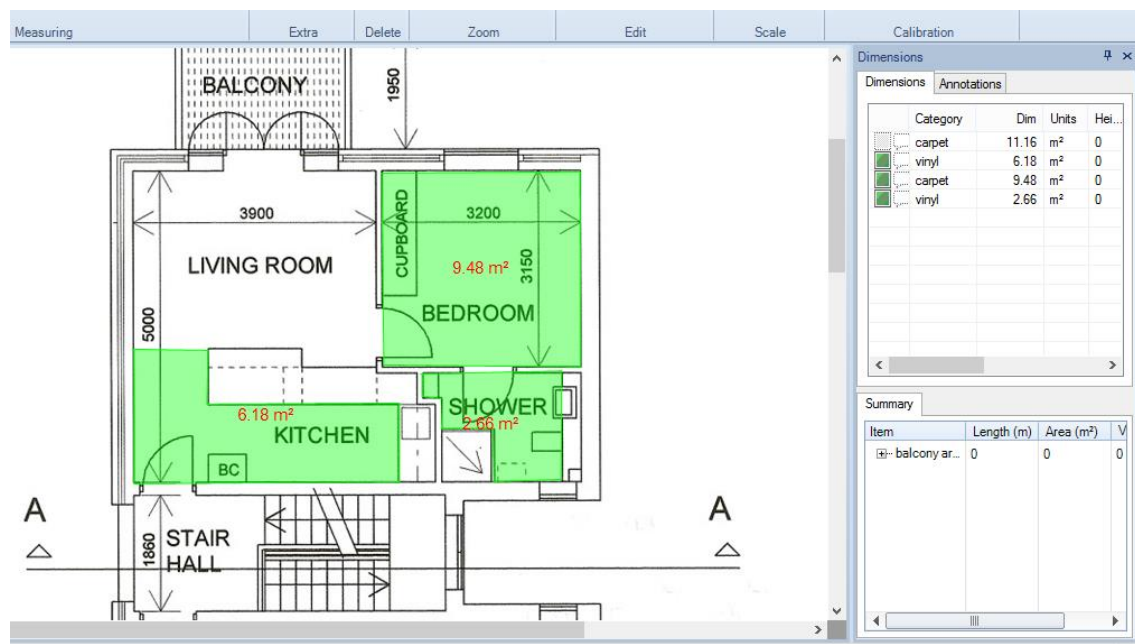## Show and hide measurements

To hide a measurement, right click on it in the Dimensions pane and select Hide.

To bulk select multiple items, hold down Ctrl on the keyboard and click on all the measurements with the mouse.

The measurement(s) will disappear from the screen but still be shown in the Dimensions panel.

The revere applies for Show.

Kind regards
The QuickScale Team
sales@quickscale.co